



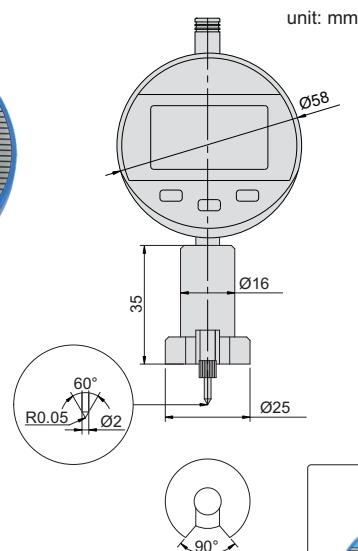

- ◆ Measure peak-to-valley height of blast cleaned surface.
If the profile is too low, the adhesion of the coating to the surface will be reduced.
If the profile is too high, it is dangerous that the profile peaks will remain non-coating, rust spots may occur.
- ◆ Meet ASTM D 4417-B
- ◆ Zero set block is included, set zero before measurement
- ◆ Buttons: on/off, zero, mm/inch, ABS/INC measurement
- ◆ Automatically power off (time is adjustable)
- ◆ Data output (cable code: 200-03 or 200-04)
- ◆ Stainless steel base

measure peak-to-valley height
of blast cleaned surface

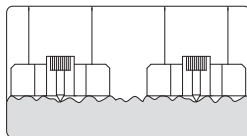

unit: mm

Set zero



Code	Range	Digital indicator stroke	Digital indicator resolution	Accuracy
489-010-02	0-12.7mm/0-0.5"	12.7mm/0.5"	0.001mm/0.00005"	±0.005mm